Active Silicon FireBird (CoaXPress)

DCAM Version

DCAM Module 24.10.4322.6873 (for 64-bit)

DRIVER 8.26.1400.6873 (for 4XCXP6-2PE8) 8.26.1400.6873 (for 2XCXP6-2PE8)

Cards

| Cards | PC Bus Type | Support OS | Note |
|--------------------|---------------------|-----------------------|----------------|
| AS-FBD-2XCXP6-2PE8 | PCI Express x8 Gen2 | Windows 10 / 11 (*25) | Half Length |
| AS-FBD-4XCXP6-2PE8 | PCI Express x8 Gen2 | 64-bit (x64) | Half Length |

Cameras

CoaXPress cameras

| Cameras | Nickname | Supported Card | Note |
|------------------|----------------|--------------------|------|
| C15440-20UP | ORCA-Fusion BT | AC EDD SYCYDS SDES | |
| C14440-20UP | ORCA-Fusion | AS-FBD-2XCXP6-2PE8 | |
| C16240-20UP/30UP | ORCA-Fire | | |
| C15550-20UP | ORCA-Quest | AS EDD AVOVDS ODES | |
| C15550-22UP | ORCA-Quest 2 | AS-FBD-4XCXP6-2PE8 | |
| C14120-20P | ORCA-Lightning | | |

Recommendation

It is highly recommended to set the BIOS to the recommended settings, else you may get sporadic corrupted images transferred to the PC - see Note (*23). Also, please turn off hibernation, else the frame grabber and camera cannot be recovered properly from waking up or fast startup — see Note (*26).



Active Silicon FireBird (CameraLink)

DCAM Version

DCAM Module 24.10.2322.6873 (for 32-bit) 24.10.4322.6873 (for 64-bit) DRIVER 8.13.3.6873 (for FBD; 2PE4L)

Cards

| Cards | Camera Link Configuration | PC Bus Type | Support OS | Note |
|----------------------|--|---------------------|--|--|
| AS-FBD-1XCLD-2PE4L-F | Deca / Dual Base / Full / Medium | PCI Express x4 Gen2 | Windows 11 (*25) 64-bit (x64) | Half Length Low Profile PCB - Full Height Bracket |
| AS-FBD-1XCLD-2PE4L-L | Deca / Dual Base / Full / Medium | PCI Express x4 Gen2 | Windows 10 (*25) 32-bit / 64-bit (x64) | Half Length Low Profile PCB - Low Height Bracket |

Cameras

Fast speed CameraLink cameras

| act op ood Camerazint Cameras | | | |
|-------------------------------|--------------------|----------------------|------|
| Cameras | Nickname | Supported Card | Note |
| C13440-20C(U) | ORCA-Flash4.0 (V3) | | |
| C10000-C01 | TDI Camera | AS-FBD-1XCLD-2PE4L-F | |
| C10000-A01 | TDI Board Camera | AS-FBD-1XCLD-2PE4L-L | |
| C10000-801 | TDI Camera | | |

CameraLink cameras

| Cameras | Nickname | Supported Card | Note |
|-----------------------------|------------------------|--|------|
| C8000-30 | | | |
| C12741-11 | InGaAs VGA Camera | | |
| C9750-xxxx(N-C) | | | |
| C10400-xx | Y Ray Line | | |
| C12450-27FGC-C | X-Ray Line | AS-FBD-1XCLD-2PE4L-F AS-FBD-1XCLD-2PE4L-L | |
| C14960-xx | | | |
| C10650-xx | | | |
| C12200-321/461 | V Pov TDI | | |
| C12300-121/321/322/323/461B | X-Ray TDI | | |
| C15400-30-50A | | | |
| C10800-xx-C | X-Ray Line Dual Energy | | |

Recommendation

It is highly recommended to set the BIOS to the recommended settings, else you may get sporadic corrupted images transferred to the PC - see Note (*23). Also, please turn off hibernation, else the frame grabber and camera cannot be recovered properly from waking up or fast startup – see Note (*26).



USB

DCAM Version

 DCAM Module
 24.10.2322.6873
 (for 32-bit)

 24.10.4322.6873
 (for 64-bit)

 DRIVER
 1.2.6.6873
 (for USB 3.0)

 2.12.2.6873
 (for others)

Cameras

| Cameras | Nickname | USB2.0 | USB3.0 | Support OS | Note |
|--|---|--------|--------|---|-------|
| C16240-20UP/30UP | ORCA-Fire | | ✓ | | |
| C15550-22UP | ORCA-Quest 2 | | ✓ | | |
| C15550-20UP | ORCA-Quest | | ✓ | | |
| C15440-20UP | ORCA-Fusion BT | | ✓ | | |
| C14440-20UP | ORCA-Fusion | | ✓ | | |
| C13440-20CU | ORCA-Flash4.0 (V3) | | ✓ | | |
| C13949-50U | Global Shutter CMOS Board Camera (12M) | | ✓ | | |
| C13770-50U | Global Shutter CMOS Board Camera (5M) | | ✓ | | |
| C13752-50U | Global Shutter CMOS Board Camera (3M) | | ✓ | | |
| C16741-40U | In GaAs SXGA Camera | | ✓ | | |
| C14041-10U | In GaAs QVGA Camera | | ✓ | | |
| C14041-20U | In GaAs QVGA Camera | | ✓ | | |
| C12741-03 | In GaAs VGA Camera | | ✓ | | |
| C11440-62U | ORCA-Flash4.0 Board | | ✓ | | |
| C11440-52U | ORCA-Flash4.0 Board | | ✓ | | (*24) |
| C11440-52U30 | OTTO/TTIGOTTIO BOUIT | | | Windows 44 (*95) | |
| C11440-42U | ORCA-Flash4.0 LT | | ✓ | Windows 11 (*25) 64-bit (x64) | (*24) |
| C11440-42U30 | | | ŕ | , , | |
| C11440-42U40 | ORCA-Flash4.0 LT3 | | ✓ | Windows 10 (*25) | |
| C11440-36U | Global Shutter CMOS Camera | | ✓ | 32-bit / 64-bit (x64) | |
| C17290 | MAICO | | ✓ | | |
| C15890 | MAICO | | ✓ | | |
| C17300-30U C17300-40U C17300-60U | X-Ray | | ✓ | | |
| C14300 | X-Ray | | ✓ | | |
| C11800 | X-Ray Line Dual Energy | | ✓ | | |
| C12849-111U C12849-112U | X-Ray CMOS | | ✓ | | |
| C12849-101U C12849-102U | X-Ray CMOS | | ✓ | | (*24) |
| C10400 | X-Ray | ✓ | | | (*27) |
| C10650 | X-Ray TDI | ✓ | | | (*27) |
| C16090 | InGaAs Area Module | | ✓ | | |
| C16091 | InGaAs Line Module | | ✓ | | |
| C9728DK-10 | | ✓ | | | (*27) |
| C9730DK-10 | Flat panel sensor | ✓ | | | (*27) |
| C9732DK-11 | | ✓ | | | (*27) |

Recommendation

It is highly recommended to set the BIOS to the recommended settings, else you may get sporadic corrupted images transferred to the PC. See Note (*23).



GigE

DCAM Version

DCAM Module 24.10.2322.6873 (for 32-bit) 24.10.4322.6873 (for 64-bit) DRIVER 6.3.06343.6873 (for fgiport) 2.2.00.6873 (for fggige2)

Cameras

| Camera or Sensors | Nickname | fgiport | fggige2 | Support OS | Note |
|-------------------|---------------------|---------|---------|---|--------|
| C15333-10E | In O - A - I in a O | ✓ | | | |
| C15333-10E04 | InGaAs Line Camera | ✓ | | | (*New) |
| C12450-27FGC-G | X-Ray Line | ✓ | | | |
| C14406DK-81 | | ✓ | | | |
| C14401DK-41 | | ✓ | | | |
| C12902D-40 | | ✓ | | | |
| C12903D-40 | | ✓ | | Windows 11 (*25) 64-bit (x64) Windows 10 (*25) 32-bit / 64-bit (x64) | |
| C10900D-40 | | ✓ | | | |
| C10901D-40 | | ✓ | | | |
| C10500D-43 | | ✓ | | | |
| C10502D-43 | Flat Panel Sensor | ✓ | | | |
| C12504D-56 | | | ✓ | , , | |
| C12505D-56 | | | ✓ | | |
| C10500D-70 | | | ✓ | | |
| C10502D-70 | | | ✓ | | |
| C14400DK-51 | | | ✓ | | |
| C14409DK-52 | | | ✓ | | |
| C16401SK-51 | | | ✓ | | |

Recommendations

- It is highly recommended to set the BIOS to the recommended settings, else you may get sporadic corrupted images transferred to the PC. See Note (*23).
- It is highly recommended to tweak the settings for the Gigabit Network Adapter for which the GigE device is connected. See the next pages.



GigE - Cont'd

Recommendations

It is highly recommended to tweak these settings for the Gigabit Network Adapter for which the GigE device is connected, provided they are available for adjustment in Device Manager \ Properties for the adapter driver:

| Property *1 | Value |
|------------------------------|-------------------------|
| Flow Control | Rx & Tx Enabled |
| Interrupt Moderation | Disabled |
| Interrupt Moderation Rate | Adaptive |
| Jumbo Packet | Maximum Value *2 |
| Maximum Number of RSS Queues | 2 Queues |
| Packet Priority & VLAN | Packet Priority Enabled |
| Receive Buffers | Maximum Value *2 |
| Speed & Duplex | Auto Negotiation |

Notables:

- *1 Because not all of these Properties may be present, set properties that can be set.
- *2 Set the maximum value that can be set, at least Jumbo Packet: 9014 and Receive Buffers: 2048.



1394 OHCI

DCAM Versions

DCAM Module 24.10.2322.6873 (for 32-bit) 24.10.4322.6873 (for 64-bit)

DRIVER 10.0.0.6873

Cameras

| Cameras | Nickname | 400Mbps Max Card Speed | 800Mbps Max Card Speed | Support OS | Note |
|-------------|--------------|------------------------------|------------------------------|-----------------------|------|
| C9100-24B | ImagEM X2 1K | n/a | BEST | Windows 11 (*25) | |
| C9100-23B | ImagEM X2 | n/a | BEST | 64-bit (x64) | |
| C11090-22B | ORCA-II | n/a | BEST | 0 : 0 : 0 (: 0 : 1) | |
| C8484-xxG02 | ORCA-xxG | good | BEST | Windows 10 (*25) | |
| C9664-01G02 | | good | BEST | 32-bit / 64-bit (x64) | |

Required

The IEEE-1394 card must have OHCl compatibility with Microsoft's Inbox Drivers.

Recommendations

- It is highly recommended to set the BIOS to the recommended settings, else you may get sporadic corrupted images transferred to the PC. See Note (*23).
- Texas Instruments XIO2213B is the best host controller for IEEE-1394 interface card compatibility with newer PC's. See Note (*28).
- Avago Technologies / LSI FW643 is the best PHY/Link IC for an IEEE-1394 interface card, but it may have trouble being recognized in newer PC's.
- PCI Express x1 cards are better than PCI 32-bit/64-bit cards in old desktops.
- ExpressCard is better than CardBus and PCMCIA cards in old notebooks.



Notes

*New: New supported hardware or OS from the 23.12.6736 release.

- *1: This note is deprecated. *2: This note is deprecated. *3: This note is deprecated. *4: This note is deprecated. *5: This note is deprecated. *6: This note is deprecated. This note is deprecated. *7: *8: This note is deprecated. This note is deprecated. *9: *10: This note is deprecated. *11: This note is deprecated. *12: This note is deprecated. *13: This note is deprecated. *14: This note is deprecated. *15: This note is deprecated. *16: This note is deprecated. *17: This note is deprecated. *18: This note is deprecated. *19: This note is deprecated. *20 This note is deprecated. *21 This note is deprecated.
- *22 The FireBird 2PE8 cards operate optimally with PCle x8 Gen2 slots. Please make sure you install this card into an electrically compatible PCle x8 Gen2 slot.



*23 For all PCIe interface options, it is highly recommended to set the BIOS to the recommended settings. For examples,

If you have a DELL Precision 5860, please follow the settings below:

(1) Power

Confirm the settings especially for the following 1 item in the "Settings-Power" options. Click the item in "Settings - Power" to confirm.

| Item | Setting name | Setting |
|------------------------------|------------------------------|---------|
| Intel Speed Shift Technology | Intel Speed Shift Technology | OFF |

(2) Virtualization Support

Confirm the settings especially for the following 1 item in the "Settings-Virtualization Support" options. Click the item in "Settings –Virtualization Support" to confirm.

| Item | Setting name | Setting |
|---|--|---------|
| Intel® Trusted Execution Technology (TXT) | Enable Intel® Trusted Execution Technology (TXT) | ON |

For 1394 OHCI cameras

| Item | Setting name | Setting |
|---|--|---------|
| Intel® Trusted Execution Technology (TXT) | Enable Intel® Trusted Execution Technology (TXT) | OFF |

(3) Performance

Confirm the settings especially for the following 4 items in the "Settings-Performance" options. Click the item in "Settings – Performance" to confirm.

| Items | Setting names | Settings |
|-----------------------------------|--|----------|
| Intel® Speed Step | Enable Intel® Speed Step Technology | OFF |
| C-States Control | Enable C-State Control | OFF |
| Intel® Turbo Boost Technology | ntel® Turbo Boost Technology Enable Intel® Turbo Boost Technology ON | |
| Intel® Hyper-Threading Technology | Enable Intel® Hyper-Threading Technology | ON |

For 1394 OHCI cameras

| Items | Setting names | Settings |
|-----------------------------------|--|----------|
| Intel® Speed Step | Enable Intel® Speed Step Technology | OFF |
| C-States Control | Enable C-State Control | OFF |
| Intel® Turbo Boost Technology | Enable Intel® Turbo Boost Technology | ON |
| Intel® Hyper-Threading Technology | Enable Intel® Hyper-Threading Technology | OFF |

If your settings are different from the settings shown in the above table, change your settings to be the same as the above and click "Apply".

f you have a DELL Precision 5820, please follow the settings below:

(1) Performance

Confirm the settings especially for the following 4 items in the "Settings-Performance" options. Click the item in "Settings – Performance" to confirm.

| Items | Correct settings | |
|---------------------------------|-----------------------------|-----------------|
| Intel® Speed Step™ | ☐ Enable Intel® Speed Step | (Unchecked OFF) |
| C-States | ☐ C states | (Unchecked OFF) |
| Intel® Turbo Boost [™] | ☑ Enable Intel® Turbo Boost | (Checked ON) |

If your settings are different from the settings shown in the above table, change your settings to be the same as the above and click "Apply".

If you have HP Z4 G4, please follow the settings below:

(1) Power Management Options

Confirm the settings especially for the following 5 items in the "Power Management Options". Click the item



in "Power Management Options" to confirm.

| Items | Correct settings |
|---------------------------------|--|
| Runtime Power Management | ☐ (Unchecked OFF) |
| Hardware P-States | ☐ (Unchecked OFF) |
| Energy/Performance Bias Control | OS Control EPB |
| Idle Power Savings | Normal with Enhanced Halt State disabled |
| PCI Express Power Management | ☐ (Unchecked OFF) |

(2) Performance Options

Confirm the settings especially for the following 6 items in the "Performance Options". Click the item in "Performance Options" to confirm.

| Items | Correct settings |
|-----------------------------------|-------------------|
| Turbo Mode | ✓ (Checked ON) |
| Intel® Hyper-Threading Technology | ☑ (Checked ON) |
| Active CPU Cores Per Processor | All |
| Sub-NUMA Clustering | ☐ (Unchecked OFF) |
| Isoc Mode | Disable |
| Performance Control | Performance Mode |

If your settings are different from the settings shown in the above table, change your settings to be the same as the above and save the new settings so they are applied on the next system restart.

If you have a PC other than a DELL Precision 5820 or HP Z4 G4 Workstation, you should use the above settings as a guide to adjust your BIOS settings to have similar effect.

The most important setting is to disable CPU C-state control.

You can refer to this article as reference:

The key point in this article is this statement: C-State Residencies (intel.com)

As the C-States get deeper, the exit latency duration becomes longer (the time to transition to C0) and the power savings becomes greater.

By disabling CPU C-state control in the BIOS, it normally causes the CPU cores in the system to always reside no higher than C1 state which is required for reliable image data transfer.


If your PC has multiple physical CPUs installed, you should also Disable "Non-Uniform Memory Access".



These hardware must be connected to a USB 3.0 compliant bus. Windows 10 and higher ship with in-box USB chi compliant drivers from Microsoft that can work with any known USB3 chipset controller), and the USB 3.0 chipset controller must be installed/operating on a PCI Express / ExpressCard Gen2 (5GT/s) capable slot / bus. Renesas µPD720202 is the most compatible USB host controller chipset with these hardware. When using the Renesas µPD720202 controller and these hardware, download this Renesas driver, even if you are using Windows 10 or higher – the Microsoft in-box drivers do not work as well as the Renesas drivers when coupled with these hardware:

http://www.ioi.com.tw/downloads/cat_106/30230_dr.zip

- (a) After you download this driver set, extract the contents to a folder on your PC.
- (b) Go to Add or remove programs, scroll down and look for this entry, and if you see it, Uninstall it:

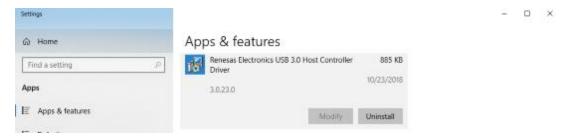

(c) Install this driver set with this exact command line (including switches) from within the folder you extracted the driver set:


RENESAS-30230-setup.exe /s /v"NO_MONITOR=1 NO_UTILITY=1 SET_SELSUS_MODE1=1 U1U2_DISABLE=1 U1U2_UTL_DISABLE=1 U1U2_PROPERTY_DISABLE=1"

Please use Windows Command Prompt. Do not use PowerShell.

This exact command line can be downloaded from this link: https://ftp.hostedftp.com/~hamamatsu/DCAM-API/Renesas/RENESAS-30230-setup.cmd

If you download this .CMD file to the same folder as RENESAS-30230-setup.exe from step (a), you should be able to execute it AsAdmin to run with the exact noted command line with switches to install the driver properly.

If you install the Renesas driver to Windows 10 or higher, it will change the driver for every Renesas µPD720201/2 controller present in your system during the time of installation. If you have multiple USB 3.0 devices (ex – a C13440-20CU ORCA-Flash4.0 (V3)) in the same system connected to independent Renesas µPD720202 controllers than the hardware mentioned above, that hardware may work with better performance if the Microsoft in-box drivers are used. For those other USB 3.0 devices, you can use Device Manager with View devices by connection, then Update Driver to the Renesas controller connected to the other devices manually to switch those controllers back to the Microsoft in-box driver. Device Manager could then look like this example with the Renesas driver for one controller, and the Microsoft in-box driver for the other:

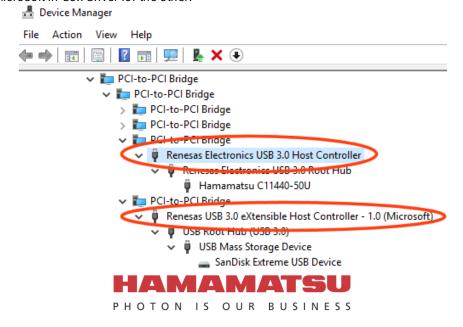

- *25 This DCAM-API can install on Windows 10 Version 1803 or higher and Windows 11. This DCAM-API is validated on Windows 10 Version 22H2, Windows 11 Version 23H2.
- *26 For Active Silicon FireBird, please disable / make unavailable hibernation for Windows 10/11. Please follow the instructions here:
 English
 - https://learn.microsoft.com/en-us/troubleshoot/windows-client/deployment/disable-and-re-enable-hibernation Japanese:
 - https://learn.microsoft.com/ja-jp/troubleshoot/windows-client/deployment/disable-and-re-enable-hibernation
- *27 If you receive this message "A driver can't load on this device (HUSBDCAM.SYS)" using these USB2.0 cameras in Windows 10/11, you need to turn off the **Memory Integrity** setting in Windows Security with these steps:
 - Start > Settings > Update (Privacy) & Security > Windows Security > Device Security, then under Core isolation, select Core isolation details. Set Memory Integrity setting from ON to OFF. You'll need to restart your computer for the changes to take effect.
- *28 In a Dell Precision 5860 Tower, when testing a Texas Instruments XIO2213B controller, such as an IOI model FWB-PCIE1X11A, it only works properly in SLOT3 PCIe4 x8.

